

## **TABLE OF CONTENTS**

### **1. Introduction**

- 1.1 Purpose of this inspection
- 1.2 Scope of this inspection
- 1.3 Limitations of Liability
- 1.4 Further Testing
- 1.5 Repair Follow-up and Annual Inspections

### **2. Your Moisture Inspection**

- North, South, East and West Elevation Grid-Style Photos with potential problem areas marked
- Summary

### **3. Typical Moisture Problems in Stucco Homes & Remedial Methods**

- 3.1 Moisture Problems Related to Unsealed Stucco Penetrations
- 3.2 Moisture Problems Related to Doors & Windows
- 3.3 Moisture Problems Related to Improper Stucco Termination at Grade
- 3.4 Moisture Problems Related to Improper Kickout and Other Roof Flashings
- 3.5 Moisture Problems Related to Improper Deck, Balcony & Patio Terminations
- 3.6 Moisture Problems Related to Cracks and Breaches in the Stucco
- 3.7 Moisture Problems Related to Stucco Accents and Flat Stucco Surfaces
- 3.8 Moisture Problems Related to Chimneys
- 3.9 Moisture Problems Related to Gutters and Downspouts
- 3.10 Moisture Problems Related to Improper Transitions (Brick to Stucco, etc.)

### **4. Stucco Information, Care and Maintenance**


- 4.1 Types of Stucco
  - Exterior Insulation Finish Systems (EIFS)
  - Traditional Hard Coat Stucco Systems
  - Water Management or Drainable EIFS Systems
- 4.2 Is Stucco a Good Cladding System?
- 4.3 Care and Maintenance

### **5. Information About Our Company**



**Smith**  
**123 Sample St.**  
**Anytown GA 30602**

**MoistureCheck**  
**Stucco & Mold Inspections**  
**4255 Old Danielsville Rd. Athens, GA 30601**  
 Athens: (706) 248-3596 Valdosta: (229) 269-0946  
 www.MoistureCheck.com Inspectorman2003@aol.com

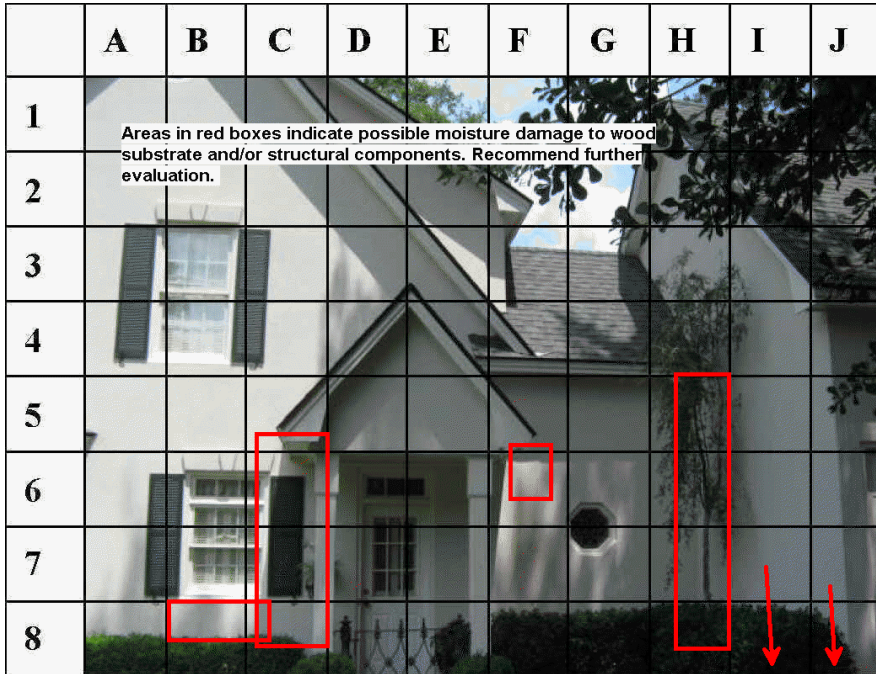

Areas in red boxes indicate possible moisture damage to wood substrate and/or structural components. Recommend further evaluation.



C5: Missing kickout flashing



Dissembler material joints need to be caulked



H4: Missing kickout flashing



F5: Missing kickout flashing



B7: Window components have moisture rot

Grid Location	Item Description	Moisture Readings	Substrate Condition	Observations
B8,C8	Window	40%40%	semisoft	Elevated moisture readings below window. Moisture may be window and/or spigot related from recent leak.
C5,C8	Kickout area	40%40%	soft	Missing kickout flashing with possible substrate damage below.
F6,F7	Kickout area	40%18%	semisoft	Missing kickout flashing with elevated moisture below and possible substrate damage where indicated.
H5,H6	Kickout area	40%40%	soft	Missing kickout flashing with possible substrate damage below.
H8-J8	Buried foam	Inaccessible	not probed	Shrubbery prevented access, but foam appears to be buried. Modifications are recommended to ensure foam is above grade and sealed along bottom edge.



**Smith**  
**123 Sample St.**  
**Anytown GA 30602**